SERVICE INFORMATION

LETTER NO. L-13 DATE January 11,1967 PAGE 1 OF___2___

TO-All owners and operators of Hughes Helicopters

SUBJECT:

INTERIM REVISION - HANDBOOK OF MAINTENANCE

INSTRUCTIONS (HMI) RE: LIMITED LIFE AND COMPONENT

OVERHAUL LIST

MODELS AFFECTED: All 269 Series Helicopters.

References

269A/A-1 Handbook of Maintenance Instructions TH55A HMI Addendum 269B Handbook of Maintenance Instructions

The information given in this Service Information Letter supersedes that noted in Table 1-7 in the 269A/A-1 HMI and 1-6 in the 269B HMI. The data is to be considered part of the HMI until formal incorporation is accomplished at the next revision cycle.

Page 1-28, Table 1-7, Limited Life & Component Overhaul List, Model 269A/A-1 Handbook of Maintenance Instructions, as reissued 1 July 1966.

States as follows:

NOMENCLATURE	PART NUMBER	PART LIFE (HOURS)
Shaft Assembly - Tail Rotor Drive (includes 5702 & 5704 end fittings)	5701	970
Drive Shaft - Main Rotor	5304	1195

HELICOPTER SUPPORT SERVICES . HUGHES TOOL COMPANY . AIRCRAFT DIVISION . CULVER CITY, CALIFORNIA LETTER NO. L-13 DATE January 11, 1967 PAGE 2 OF 2

Revise to read:

NOMENCLATURE	PART NUMBER	PART LIFE (HOURS)
Shaft Assembly - Tail Rotor Drive (includes 5702 & 5704 end fittings)	5701	3000
*Drive Shaft - Main Rotor	5305-3	1735

Page 1-15/1-16, Table 1-6, Limited Life Parts List, Model 269B Handbook of Maintenance Instructions, as revised 15 Sept. 65.

States as follows:

NOMENCLATURE	PART NUMBER	PART LIFE (HOURS)
Shaft Assembly - Tail Rotor Drive (includes 5702 & 5704 end fitting)	5701	970
Drive Shaft - Main Rotor	5304	1195
Revised to read:		
NOMENCLATURE	PART NUMBER	PART LIFE (HOURS)
Shaft Assembly - Tail Rotor Drive (includes 5702 & 5704 end fitting)	5701	3000
*Drive Shaft - Main Rotor	5305-3	1735

^{*}Main rotor drive shaft, part number 5304, is an undrilled drive shaft. After drilling the main rotor drive shaft for mating to the main rotor hub, it is identified by part number 5305-3.